

LUSCOMBE AIRPLANE CORPORATION
West Trenton, New Jersey

ENGINEERING BULLETIN No. 16

August 8, 1941
Page 1 of 2

RECOMMENDED REPAIR FOR CRACKS IN REAR FIN SPAR AT UPPER HINGE BRACKET

Aircraft affected: All Luscombe Model 8 Series up to and including Serial No. 1776

The occurrence of cracks on the rear fin spar at the upper hinge bracket has led to the addition of a reinforcement plate on all fin spars for new aircraft at our factory. The Civil Aeronautics Administration has been informed of these facts, and it will probably recommend or insist that all Luscombe Aircraft manufactured before this addition be inspected and that all aircraft having these failures be repaired as outlined below and illustrated on the accompanying page.

A record of the inspection and/or repair should be entered in the airplane log book.

REPAIR PROCEDURE

1. Should the reinforcement plate (Luscombe part #18451) be insufficiently large to fully cover all cracks, or should any crack be more than one-half inch long, the spar should be replaced.
2. Providing the spar is repairable, remove enough rivets to allow the fin skin to be peeled back sufficiently to allow room for a dolly, and remove anchor nut (AC 366-F428)
3. Relieve all cracks with a #30 (.1285) drill
4. Drill spar to match reinforcement plate
5. Rivet plate in place
6. Drill plate to match anchor nut
7. Rivet a new anchor nut in place
8. Replace covered rivets in skin

Retyped March 1, 1960
SILVAIRE AIRCRAFT CO.
P.O. BOX 719
FORT COLLINS, COLORADO

ped

REAR FIN SPAR
LUSCOMBE PART
#38411

REINFORCEMENT PLATE -
LUSCOMBE PART #18451
MAT'L: .040 17ST ALC

PLATE NUT
AC.366-F42B

