

LUSCOMBE AIRPLANE CORPORATION
P.O. Box 2128, Dallas 1, Texas

August 6, 1948

SERVICE BULLETIN NUMBER 3-48

TO: All Silvaire Owners & Operators
FROM: Service Department
SUBJECT: Rework of Rear Spar Hinge Bracket #19421
SERIAL NOS. AFFECTED: 1925 - 6283 Inclusive

Several cases of cracks developing in the side flanges of the stabilizer attaching bracket at the point of union with the top flange have been reported to this office.

The condition is not considered dangerous; however you are urged to carefully inspect all aircraft within the block of serial numbers noted, as soon as possible. Prevention of cracks may be accomplished by filing the corner noted in the attached sketch to a one-quarter (.250) radius.

If inspectio of the fitting indicates that replacement is necessary rather than rework to this bulletin, new fittings may be purchased through the Service Department. Silvaire Aircraft Co., P.O. Box 719, Fort Collins, Colorado

Approved /s/ H.G. Erickson
Chief Engineer

Approved /s/ D.S. Brown
Asst. Service Manager

Retyped and Revised March 2, 1960
SILVAIRE AIRCRAFT CO.
P.O. BOX 719
FORT COLLINS, COLORADO

ped

BULLETIN 3-48
7-10-48

