


LUSCOMBE AIRPLANE CORPORATION
West Trenton, New Jersey

ENGINEERING BULLETIN #12


May 13, 1940

REF: Model 8A with injector engines.

Cut vent line 2" from 90° elbow at gascolator. Make flexible joint in line at this point with 1/4 I.D. Neoprene hose 4" long. Use hose clamps to fasten nose to tube, as in sketch A.

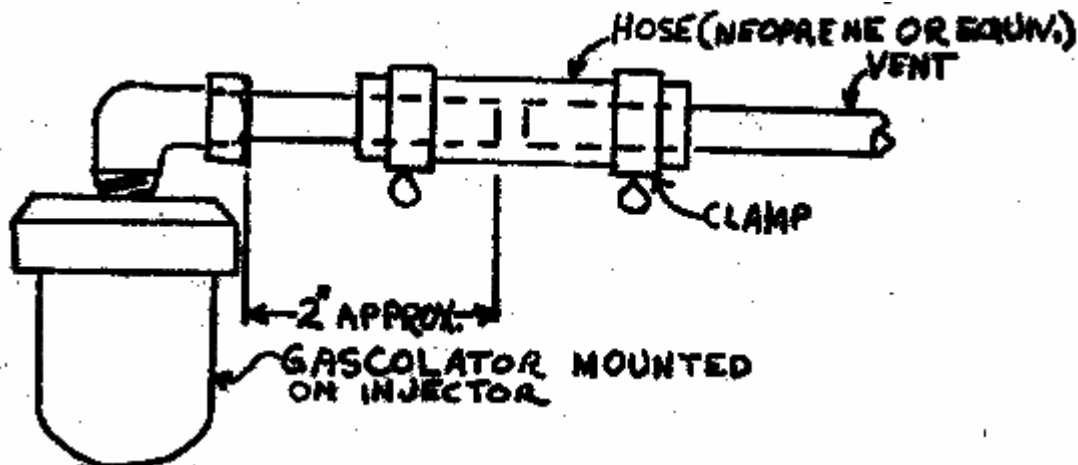

Bend the vent line forward 28° from perpendicular at the outlet in the leading edge of wing, as in Sketch B.

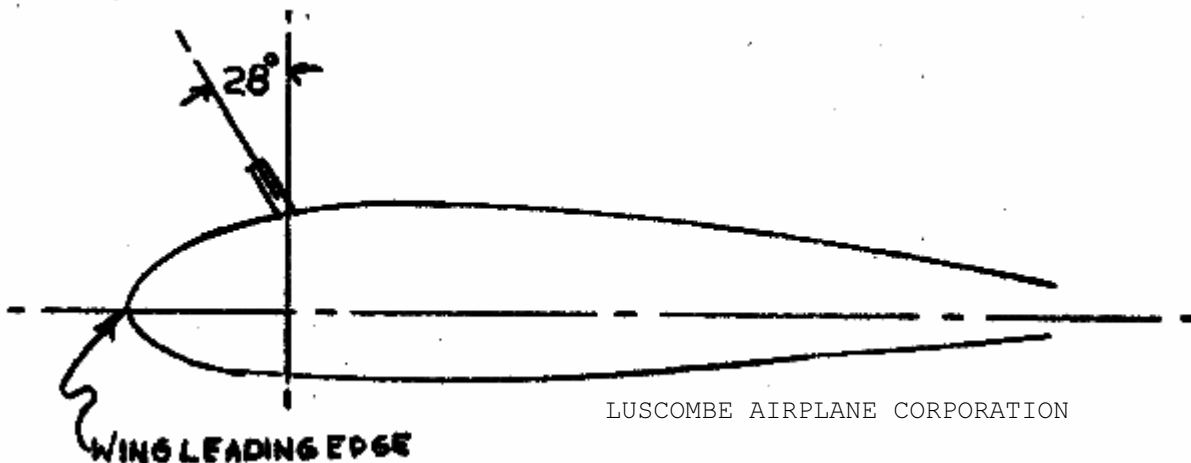

J.G. Rising
Chief Engineer

J.G. Rising/C

Retyped March 1, 1960
SILVAIRE AIRCRAFT CO.
P.O. BOX 719
FORT COLLINS, COLORADO

PED